SHINOHAWA

DIGITAL MULTIMETER

KM-9696 SERIES

DISPLAY		Red high efficiency LED high 9.14mm (.36")
ACCURACY		± 0.5% ± 2 digit
OPERATING CONDITION		-10˚C~50˚C (20% to 90% RH non-condensed)
DIELECTRIC STRENGTH		AC 2KV/1min
AUX・POWER		AC110V/220V 50/60Hz
MEASUREMENT RANGE	KM96-3A	**Display:** 3 Windows. **Function:** Display 3 Phase Current Simultaneously. **Ranges:** Direct Measurement Current: AC 0 – 5A.. For Current above 5A, Current Transformer (C.T.) must be used. Press Key to select desirable C. T. Ratio. The following are the available C.T. Ratios: 10A/5A, 15A/5A, 20A/5A, 25A/5A, 30A/5A, 40A/5A, 50A/5A,60A/5A, 70A/5A, 75A/5A, 80A/5A, 100A/5A, 120A/5A, 150A/5A, 160A/5A,200A/5A, 250A/5A, 300A/5A, 400A/5A, 500A/5A, 600A/5A, 700A/5A, 750A/5A, 800A/5A, 1kA/5A, 1.2kA/5A,1.5kA/5A, 1.6kA/5A, 2kA/5A, 2.5kA/5A, 3kA/5A, 4kA/5A, 5kA/5A,6kA/5A, 7kA/5A,7.5kA/5A, 8kA/5A. Note: Red LED indicates Ampere. Green LED indicates Kilo-ampere (kA).
	KM96-3V	**Display:** 3 windows. **Function:** Display 3 Phase Voltage (L-L or L-N) Simultaneously. **Range:** AC 50-600V.
	KM96-3AV	**Display:** 3 windows. **Function:** Press Key "A/V" For Selecting Measuring Function: Display 3 Phase Current Simultaneously OR Display 3 Phase Voltage (L-L or L-N) Simultaneously. **Ranges:** Direct Measurement Current: AC 0– 5A. For Current above 5A, Current Transformer (C.T.) must be used. Press Key to select desirable C. T. Ratio. The following are the available C.T. Ratios: 10A/5A, 15A/5A, 20A/5A, 25A/5A, 30A/5A, 40A/5A, 50A/5A,60A/5A, 70A/5A, 75A/5A, 80A/5A, 100A/5A, 120A/5A, 150A/5A, 160A/5A,200A/5A, 250A/5A, 300A/5A, 400A/5A, 500A/5A, 600A/5A, 700A/5A, 750A/5A, 800A/5A, 1kA/5A, 1.2kA/5A,1.5kA/5A, 1.6kA/5A, 2kA/5A, 2.5kA/5A, 3kA/5A, 4kA/5A, 5kA/5A,6kA/5A, 7kA/5A,7.5kA/5A, 8kA/5A. Note: Red LED indicates Ampere. Green LED indicates Kilo-ampere (kA). Voltage: AC 50-600V.
STANDARD FEATURES		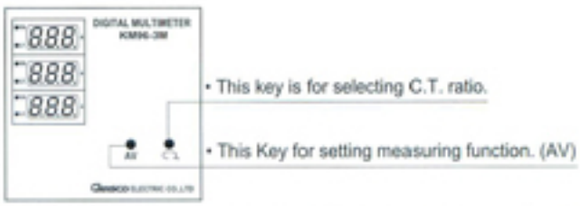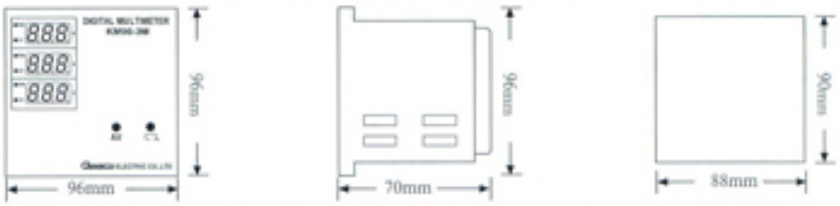
DIMENSION